



Consumer Response Group

6500 W. Cortland Street * Chicago, IL 60707 * Phone: 773-889-8870 * FAX: 773-622-2269

March 16, 2004

Page 1 of 1

TECHNICAL SERVICE BULLETIN 10031

MODEL(S): 148

DESCRIPTION: Replacing the MB8719 PLL chip with an MMB8719.

ACTION: Replace the following additional parts:

- Change C85 to 33pF
- Change C86 to 39pF
- Change C88 to 100pF, type C0G or NPO
- Change C111 to 0.1 μ F
- If L501 is installed, short it.

ADJUSTMENTS: Realign the PLL section.

NOTES: None.